



VISION • EXPERIENCE • RESULTS

[www.etminc.com](http://www.etminc.com)

tel 904-642-8990 • fax 904-646-9485

14775 Old St. Augustine Road • Jacksonville, Florida 32258

## **Subsurface Utility Engineering Reports**

### **JEA Galvanized Pipe Program**

### **College Street Area – Package C**


ETM Surveying & Mapping Inc

**England-Thims & Miller, Inc.**

ENGINEERS • PLANNERS • SURVEYORS • GIS • LANDSCAPE ARCHITECTS

Jacksonville • Lake Mary • Palm Coast

CA-00002584 LC-0000316

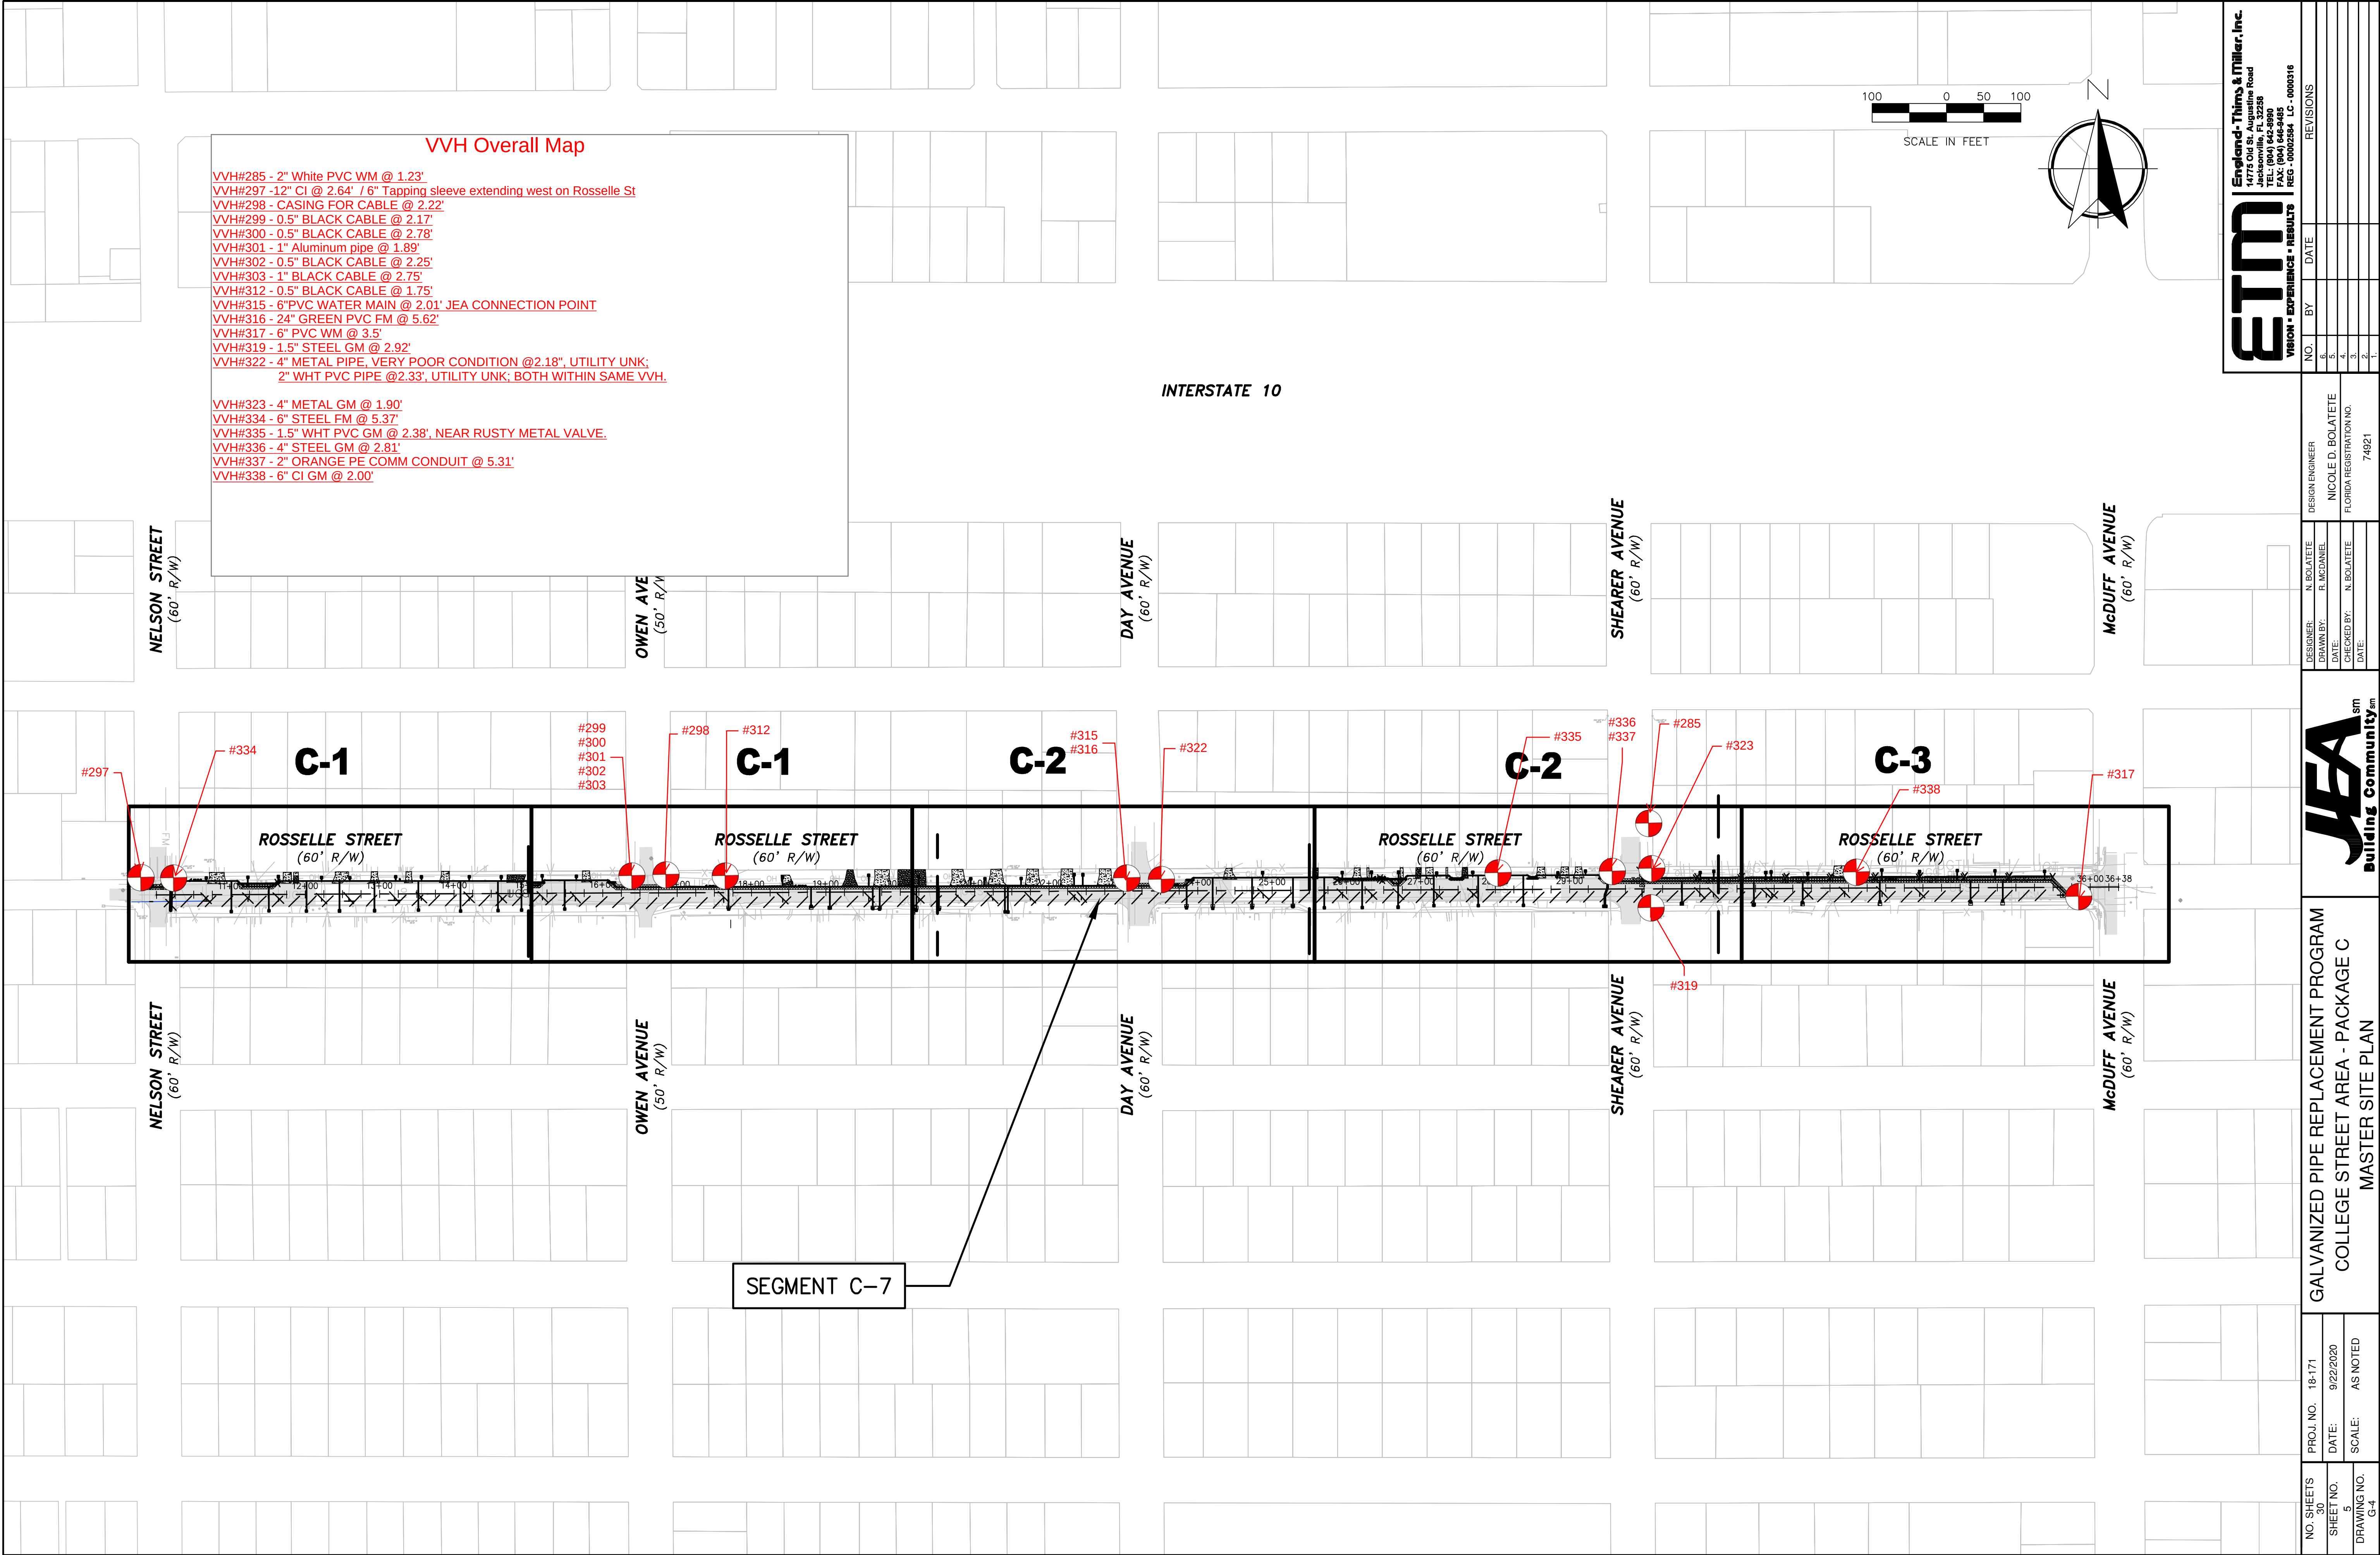

**VVH Overall Map**

VVH#285 - 2" White PVC WM @ 1.23'  
VVH#297 -12" CI @ 2.64' / 6" Tapping sleeve extending west on Rosselle St  
VVH#298 - CASING FOR CABLE @ 2.22'  
VVH#299 - 0.5" BLACK CABLE @ 2.17'  
VVH#300 - 0.5" BLACK CABLE @ 2.78'  
VVH#301 - 1" Aluminum pipe @ 1.89'  
VVH#302 - 0.5" BLACK CABLE @ 2.25'  
VVH#303 - 1" BLACK CABLE @ 2.75'  
VVH#312 - 0.5" BLACK CABLE @ 1.75'  
VVH#315 - 6"PVC WATER MAIN @ 2.01' JEA CONNECTION POINT  
VVH#316 - 24" GREEN PVC FM @ 5.62'  
VVH#317 - 6" PVC WM @ 3.5'  
VVH#319 - 1.5" STEEL GM @ 2.92'  
VVH#322 - 4" METAL PIPE, VERY POOR CONDITION @2.18", UTILITY UNK;  
2" WHT PVC PIPE @2.33', UTILITY UNK; BOTH WITHIN SAME VVH.

VVH#323 - 4" METAL GM @ 1.90'  
VVH#334 - 6" STEEL FM @ 5.37'  
VVH#335 - 1.5" WHT PVC GM @ 2.38', NEAR RUSTY METAL VALVE.  
VVH#336 - 4" STEEL GM @ 2.81'  
VVH#337 - 2" ORANGE PE COMM CONDUIT @ 5.31'  
VVH#338 - 6" CI GM @ 2.00'

ETM

England, Thins & Miller, Inc.  
14775 Old St. Augustine Road  
Jacksonville, FL 32218  
TEL: (904) 642-9890  
FAX: (904) 642-4444  
REG: 0000259 LC - 0000316

VISION • EXPERIENCE • RESULTS

| NO. | BY | DATE | REVISIONS |
|-----|----|------|-----------|
| 1.  |    |      |           |
| 2.  |    |      |           |
| 3.  |    |      |           |
| 4.  |    |      |           |
| 6.  |    |      |           |

| DESIGNER:   | DESIGN ENGINEER          |
|-------------|--------------------------|
| N. BOLATETE | NICOLE D. BOLATETE       |
| R. MCDANIEL | FLORIDA REGISTRATION NO. |
| N. BOLATETE | 74921                    |

JEA

Building Community<sup>sm</sup>

GALVANIZED PIPE REPLACEMENT PROGRAM  
COLLEGE STREET AREA - PACKAGE C  
MASTER SITE PLAN

|             |           |           |
|-------------|-----------|-----------|
| NO. SHEETS  | PROJ. NO. | 18-171    |
| 30          | DATE:     | 9/22/2020 |
| SHEET NO.   | SCALE:    | AS NOTED  |
| 5           |           |           |
| DRAWING NO. |           |           |
| G-4         |           |           |

G:\18-171 Galv Pipe\Design\College St\Package LandDev\Design Plots\18-171 PACKAGE C MASTER PLAN.dwg PLOTTED: Sep. 22, 20 -- 12:04 PM, BY: CAD Test




# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 285  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 09290667 0

|                                                                                                                                                                                |                            |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------|------------------------------------------------------|
| REPORT BY: <u>Phild</u>                                                                                                                                                        | ASSISTED BY: <u>PPhost</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: _____                                                                                                                                                              |                            | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>4/17/20</u>       | TIME: _____                                          |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                      |                            | REQUESTED UTILITY: <u>Water main</u>                 |
| PAVEMENT TYPE: _____                                                                                                                                                           |                            | LOCATED UTILITY: _____                               |
| PAVEMENT CONDITION: <u>Soft dis NA</u>                                                                                                                                         |                            | MATERIAL AS FOUND: <u>WM PVC</u>                     |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                            | COLOR: <u>white</u>                                  |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                            | SIZE AS EXPECTED: _____                              |
| INSTALLED: <u>IRON ROD &amp; CAP LB3624 or Hub &amp; tack</u>                                                                                                                  |                            | SIZE AS FOUND: <u>2.25"</u>                          |
| AT: <u>CROWN, E</u>                                                                                                                                                            |                            | UTILITY CONDITION: <u>fair</u>                       |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                            | PAINT FLAGGED: <u>Blue</u>                           |
| NOTES: <u>FND 2" white pvc wm @ 1.23'</u>                                                                                                                                      |                            |                                                      |
| <u>see pirs 135-3786 / 135-3787</u>                                                                                                                                            |                            |                                                      |
| Approx. STA TION (±): _____                                                                                                                                                    | OFFSET: _____              |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

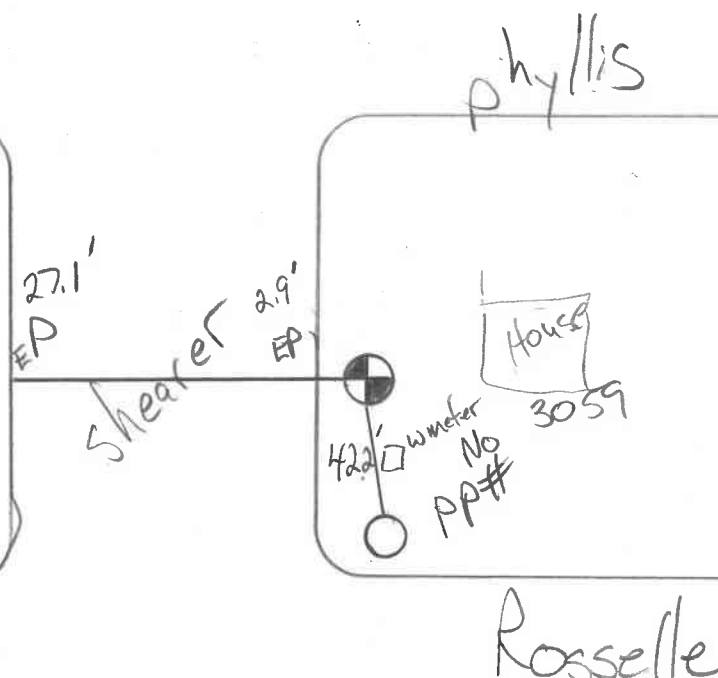








# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 297  
PROJECT NO.:  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.:  
SUNSHINE-811 TICKET: 0920006658

|                                                                                                                                                    |                          |                                                  |
|----------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------|--------------------------------------------------|
| REPORT BY: Phero                                                                                                                                   | ASSISTED BY: P. Chesteen | PROJECT NAME: JEA Galvanized Pipe Replacement    |
| CHECKED BY:                                                                                                                                        |                          | VVH REQUESTED BY: ETM                            |
| NO. HOLES: 1                                                                                                                                       | DATE: 4/23/20            | TIME:                                            |
| UTILITY OWNER: JEA                                                                                                                                 |                          | REQUESTED UTILITY: Water main                    |
| PAVEMENT TYPE: Soft dig                                                                                                                            |                          | LOCATED UTILITY:                                 |
| PAVEMENT CONDITION: NA                                                                                                                             |                          | MATERIAL AS FOUND: WM 6" connection<br>DVE/steel |
| SOIL CONDITIONS: SOFT <input checked="" type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input type="checkbox"/> |                          | SIZE AS EXPECTED: SIZE AS FOUND: 6" / 12"        |
| PROPOSED: Determine pipe material                                                                                                                  |                          | UTILITY CONDITION: Good                          |
| INSTALLED: IRON ROD & CAP LB36                                                                                                                     |                          | PAINT FLAGGED: Blue                              |
| AT: CROWN, EDGE, OTHER: 24" or 1.95' the pos to the top of Iron                                                                                    |                          |                                                  |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                |                          |                                                  |
| NOTES:<br>FND 6" connection of 6" to 12" @ 2.64'<br>2.64' to Coupler on WM 12"<br>see pics 135-3814 / 135-3815                                     |                          |                                                  |
| Ap prox. STATION (±)                                                                                                                               | OFFSET:                  |                                                  |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

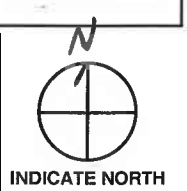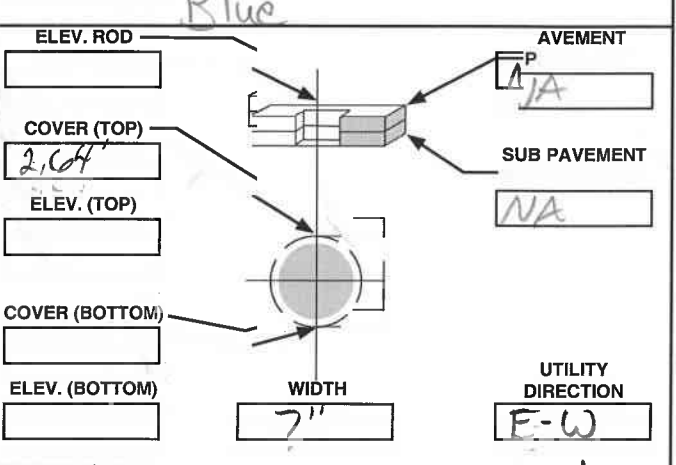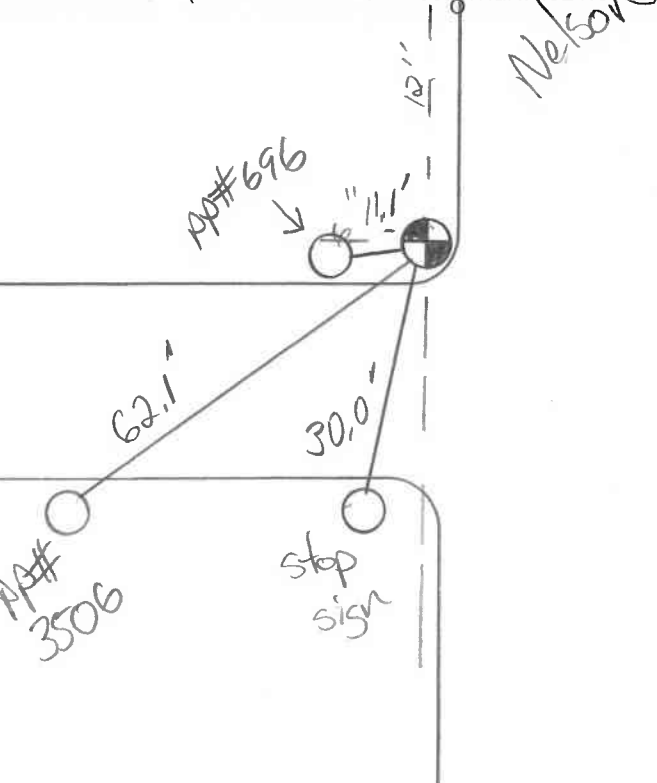

Rosselle






# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 29  
PROJECT NO.: 8  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 09200663

|                                                                                                                                                                                       |                                      |                                                      |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|------------------------------------------------------|
| REPORT BY: <u>P Her old</u>                                                                                                                                                           | ASSISTED BY: <u>P Chest</u>          | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: _____                                                                                                                                                                     | VVH REQUESTED BY: <u>ETM</u>         |                                                      |
| NO. HOLES: <u>1</u>                                                                                                                                                                   | DATE: <u>4/23/20</u>                 | TIME: _____                                          |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                             | REQUESTED UTILITY: <u>Water main</u> | LOCATED UTILITY: <u>AT #</u>                         |
| PAVEMENT TYPE: <u>soft dis</u>                                                                                                                                                        | MATERIAL AS FOUND: <u>steel</u>      | COLOR: <u>rust</u>                                   |
| PAVEMENT CONDITION: <u>N/A</u>                                                                                                                                                        | SIZE AS EXPECTED: _____              | SIZE AS FOUND: <u>4.25"</u>                          |
| SOIL CONDITIONS: <input checked="" type="checkbox"/> SOFT <input type="checkbox"/> DR <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> | UTILITY CONDITION: <u>fair</u>       | PAINT FLAGGED: _____                                 |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                              |                                      |                                                      |
| INSTALLER: <u>RON ROD &amp; C</u>                                                                                                                                                     | ELEV. ROD _____                      |                                                      |
| AT: <u>CROWN</u> , EDGE, OTHER _____                                                                                                                                                  | COVER (TOP) <u>2.22'</u>             |                                                      |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                            | ELEV. (TOP) _____                    |                                                      |
| NOTES:<br><u>FIND 4" Metal pipe @ 2.22'</u><br><u>5" com inside steel conduit.</u><br><u>See pic 135-3816 / 135-3824</u>                                                              | COVER (BOTTOM) _____                 |                                                      |
| Approx. STATION (±) _____                                                                                                                                                             | ELEV. (BOTTOM) _____                 |                                                      |
| OFFSET: _____                                                                                                                                                                         | WIDTH <u>4"</u>                      |                                                      |
|                                                                                                                                                                                       | UTILITY DIRECTION <u>E-W</u>         |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

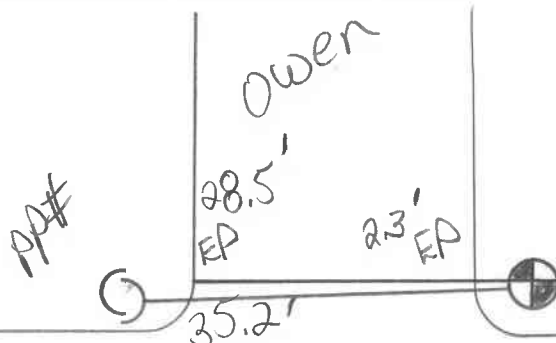

Rosselle




# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 299  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 052006663

|                                                                                                                                                                                |                                 |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|------------------------------------------------------|
| REPORT BY: <u>P. Harold</u>                                                                                                                                                    | ASSISTED BY: <u>P. Chasteen</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: _____                                                                                                                                                              |                                 | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>4/23/20</u>            | TIME: _____                                          |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                      |                                 | REQUESTED UTILITY: <u>Water main</u>                 |
| PAVEMENT TYPE: _____                                                                                                                                                           |                                 | LOCATED UTILITY: _____                               |
| PAVEMENT CONDITION: <u>Soft dis</u>                                                                                                                                            |                                 | MATERIAL AS FOUND: <u>Cable</u>                      |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                                 | COLOR: <u>Black</u>                                  |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                                 | SIZE AS EXPECTED: _____                              |
| INSTALLED: <u>IRON ROD</u> <u>2</u> r                                                                                                                                          |                                 | SIZE AS FOUND: <u>0.5"</u>                           |
| A <u>T: CROWN</u> , EDGE, OTHER _____                                                                                                                                          |                                 | UTILITY CONDITION: <u>Good</u>                       |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                                 | PAINT FLAGGED: <u>Orange</u>                         |
| NOTES:<br><u>FIND 0.5" DBFOC @ 2.17</u><br><u>see pic 135-3817 135-3818</u>                                                                                                    |                                 |                                                      |
| Approx. STA <u>135-3817</u> TION (±)                                                                                                                                           | OFFSET: _____                   |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

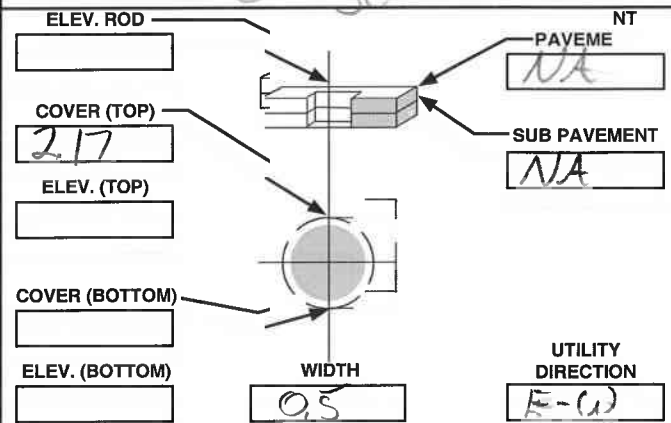

Rosselle



## VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 300  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 092006663

|                                                                                                                                                    |                                 |                                               |                                                 |
|----------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|-----------------------------------------------|-------------------------------------------------|
| REPORT BY: <u>P. Howard</u>                                                                                                                        | ASSISTED BY: <u>P. Chastain</u> | PROJECT NAME: JEA Galvanized Pipe Replacement |                                                 |
| CHECKED BY: _____                                                                                                                                  |                                 | VVH REQUESTED BY: ETM                         |                                                 |
| NO. HOLES: <u>1</u>                                                                                                                                | DATE: <u>4/23/20</u>            | TIME: _____                                   | REQUESTED UTILITY: <u>Water main</u> <u>Com</u> |
| UTILITY OWNER: <u>JEA AT&amp;T</u>                                                                                                                 |                                 | LOCATED UTILITY: <u>Com</u>                   |                                                 |
| PAVEMENT TYPE: <u>Soft dis</u>                                                                                                                     |                                 | MATERIAL AS FOUND: <u>DB FOC</u>              | COLOR: <u>Black</u>                             |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                      |                                 | SIZE AS EXPECTED: _____                       | SIZE AS FOUND: <u>0.5"</u>                      |
| SOIL CONDITIONS: SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                                 | UTILITY CONDITION: <u>Good</u>                |                                                 |
| PROPOSED: Determine pipe material                                                                                                                  |                                 | PAINT FLAGGED: <u>Orange</u>                  |                                                 |
| INSTALLED: IRON ROD & CAP LB3624 or <u>Nail &amp; disk</u>                                                                                         |                                 | ELEV. ROD _____                               |                                                 |
| AT: CROWN, EDGE, OTHER _____                                                                                                                       |                                 | COVER (TOP) <u>2.78</u>                       |                                                 |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                |                                 | ELEV. (TOP) _____                             |                                                 |
| NOTES:<br><u>FIND 0.5", Black DB FOC @ 2.78'</u>                                                                                                   |                                 | COVER (BOTTOM) _____                          |                                                 |
| <u>see pics 135-381021/135-3823</u>                                                                                                                |                                 | ELEV. (BOTTOM) _____                          |                                                 |
| Approx. STATION (±)                                                                                                                                | OFFSET:                         | WIDTH <u>0.5"</u>                             | UTILITY DIRECTION <u>E-W</u>                    |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

Oweas





# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 301  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 2

|                                                                                                                                                                                                                 |                                |                                                      |                                   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------|------------------------------------------------------|-----------------------------------|
| REPORT BY: <u>P. Hero H</u>                                                                                                                                                                                     | ASSISTED BY: <u>P. Cheston</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |                                   |
| CHECKED BY: _____                                                                                                                                                                                               | VVH REQUESTED BY: <u>ETM</u>   |                                                      |                                   |
| NO. HOLES: <u>1</u>                                                                                                                                                                                             | DATE: <u>4/23/20</u>           | TIME: _____                                          | REQUESTED UTIL: <u>Water main</u> |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                                                       |                                | LOCATED UTILITY: <u>unk</u>                          |                                   |
| PAVEMENT TYPE: <u>5' soft d's</u>                                                                                                                                                                               | MATERIAL AS FOUND: <u>unk</u>  |                                                      | COLOR: <u>Gray</u>                |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                                                   | SIZE AS EXPECTED: _____        |                                                      | SIZE AS FOUND: <u>Gray</u>        |
| SOIL CONDITIONS: <u>S</u> <input type="checkbox"/> <u>IFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> | UTILITY CONDITION: <u>fair</u> |                                                      |                                   |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                                                        |                                | PAINT FLAGGED: <u>pink</u>                           |                                   |
| INSTALLED: IRON ROD & CAP LB3624 or <u>1" disk</u>                                                                                                                                                              |                                | ELEV. ROD: _____                                     |                                   |
| AT: <u>CROWN</u> , EDGE, OTHER _____                                                                                                                                                                            |                                | COVER (TOP): <u>1.89</u>                             |                                   |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                                                      |                                | ELEV. (TOP): _____                                   |                                   |
| NOTES:<br><u>FWD 1" Aluminum pipe @ 1.89</u><br><u>see pics 135-3822 / 135-3823</u>                                                                                                                             |                                | COVER (BOTTOM): _____                                |                                   |
| App. STATION (±): _____                                                                                                                                                                                         | OFFSET: _____                  | ELEV. (BOTTOM): _____                                |                                   |
| FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)                                                                                                                                                           |                                | WIDTH: <u>1"</u>                                     |                                   |
|                                                                                                                                                                                                                 |                                | UTILITY DIRECTION: <u>N-S</u>                        |                                   |



PP#  
3301



EP 6.85

EP 34.85

Owens



INDICATE NORTH



Roselle






# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 300  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: \_\_\_\_\_


|                                                                                                                                                                                |                                 |                                                          |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|----------------------------------------------------------|
| REPORT BY: <u>P. Keroold</u>                                                                                                                                                   | ASSISTED BY: <u>P. Chasteau</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u>     |
| CHECKED BY: _____                                                                                                                                                              |                                 | VVH REQUESTED BY: <u>ETM</u>                             |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>4/23/20</u>            | TIME: _____                                              |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                      |                                 | REQUESTED UTILITY: _____                                 |
| PAVEMENT TYPE: <u>Soft dig</u>                                                                                                                                                 |                                 | LOCATED UTILITY: <u>Water main DB cable in metal box</u> |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                  |                                 | MATERIAL AS FOUND: <u>DB Cable</u>                       |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                                 | COLOR: <u>Black</u>                                      |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                                 | SIZE AS EXPECTED: _____                                  |
| INSTALLED: <u>IRON ROD &amp; CAP LB3624 or Nail &amp; die ABC</u>                                                                                                              |                                 | SIZE AS FOUND: <u>0.5"</u>                               |
| AT: <u>CROWN</u> , EDGE, OTHER _____                                                                                                                                           |                                 | UTILITY CONDITION: <u>Good</u>                           |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                                 | PAINT FLAGGED: <u>Orange</u>                             |
| NOTES:<br><u>FIND 0.5" black DB cable @ 2.25</u><br><u>inside of metal pipe 4" comes out</u><br><u>and splits north and south</u><br><u>see pics 135-3800122 / 135-38023</u>   |                                 |                                                          |
| Approx. STATION (±): _____                                                                                                                                                     | OFFSET: _____                   |                                                          |

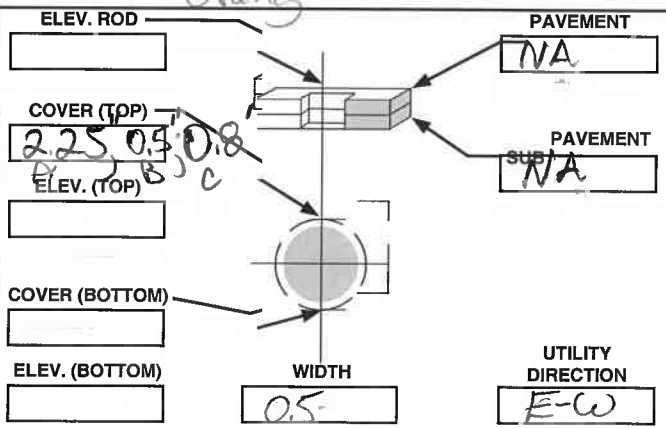

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)



sidewalk

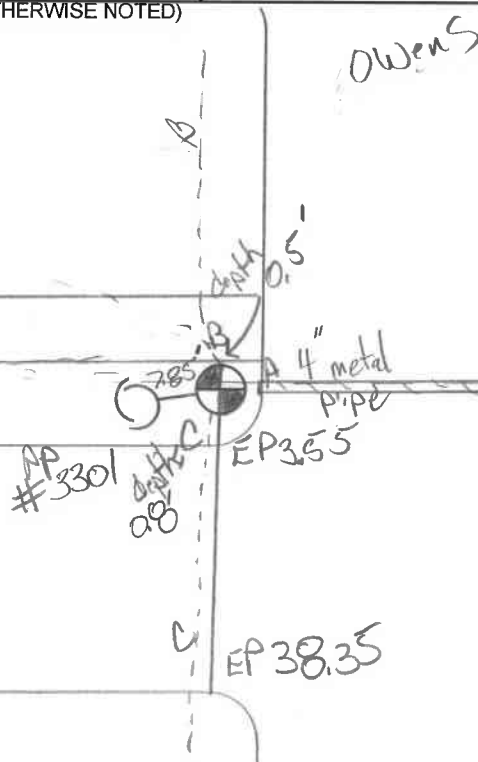





# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 303  
PROJECT NO.: 303  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: 292076663  
SUNSHINE-811 TICKET

|                                                                                                                                                                                |                                |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------|------------------------------------------------------|
| REPORT BY: <u>P Herold</u>                                                                                                                                                     | ASSISTED BY: <u>P Chasteen</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY:                                                                                                                                                                    |                                | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>4/29/20</u>           | TIME:                                                |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                      |                                | REQUESTED UTILITY: <u>Water main</u>                 |
| PAVEMENT TYPE: <u>Soft dis</u>                                                                                                                                                 |                                | LOCATED UTILITY: <u>DB cable</u>                     |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                  |                                | MATERIAL AS FOUND: <u>cable</u>                      |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                                | COLOR: <u>Black</u>                                  |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                                | SIZE AS EXPECTED:                                    |
| INSTALLED: <u>IRON ROD &amp; CAP LB3</u> or <u>624</u>                                                                                                                         |                                | SIZE AS FOUND: <u>1</u>                              |
| AT: <u>CROWN</u> , EDGE, OTHER                                                                                                                                                 |                                | UTILITY CONDITION: <u>Good</u>                       |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                                | PAINT FLAGGED: <u>Orange</u>                         |
| NOTES: <u>Black</u><br><u>FIND 1" Direct Buried Cable @ 2.75'</u>                                                                                                              |                                |                                                      |
| App. STATION (±):                                                                                                                                                              | OFFSET:                        |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

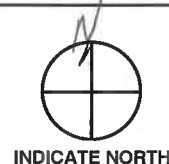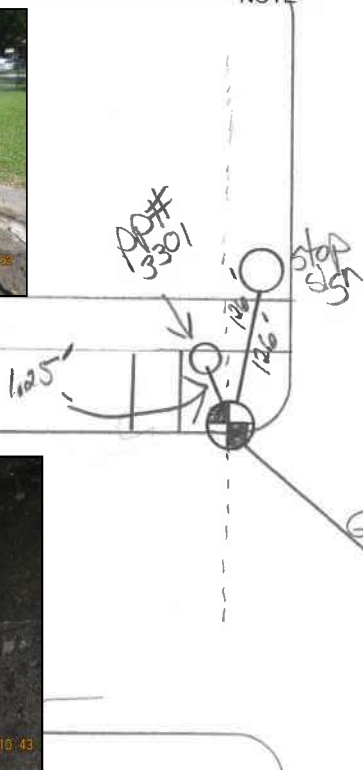

# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 312 C  
PROJECT NO.: 19-041.00  
WORK ORDER NO.: 19-041.00  
CLIENT PROJECT NO.: ET 0920126563  
SUNSHINE-811 TICK

|                                                                                                                                                                                        |                              |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|
| REPORT BY: <u>P. Harold</u>                                                                                                                                                            | ASSISTED BY: <u>P. Chase</u> |
| CHECKED BY:                                                                                                                                                                            |                              |
| NO. HOLES: <u>1</u>                                                                                                                                                                    | DATE: <u>4/30/20</u> TIME:   |
| UTILITY OWNER: <u>JEA AT&amp;T</u>                                                                                                                                                     |                              |
| PAVEMENT TYPE: <u>Soft d/s</u>                                                                                                                                                         |                              |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                          |                              |
| SOIL CONDITIONS: <input checked="" type="checkbox"/> SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                              |
| PROPOSED: Determine pipe material                                                                                                                                                      |                              |
| INSTALLED: IRON ROD <u>PL 3</u> & CA <u>B 624</u> or                                                                                                                                   |                              |
| A: <u>CROWN</u> EDGE, OTHER                                                                                                                                                            |                              |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                             |                              |
| NOTES:<br><u>FIND 0.5" Black DB Cable @ 1.75'</u>                                                                                                                                      |                              |
| <u>see p/s 135-3841 / 135-3842</u>                                                                                                                                                     |                              |
| Approx. STA                                                                                                                                                                            | OFFSET:                      |


|                                                      |                              |
|------------------------------------------------------|------------------------------|
| PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |                              |
| VVH REQUESTED BY: <u>ETM</u>                         |                              |
| REQUESTED UTILITY: <u>Water main AT&amp;T</u>        |                              |
| LOCATED UTILITY:                                     |                              |
| MATERIAL AS FOUND: <u>Comp DB cable</u>              | COLOR: <u>Black</u>          |
| AS EXPECTED:                                         | SIZE AS FOUND: <u>0.5"</u>   |
| UTILITY CONDITION: <u>Good</u>                       |                              |
| PAINT FLAGGED: <u>Orange</u>                         |                              |
| ELEV. ROD                                            | PAVEMENT <u>NA</u>           |
| COVER (TOP) <u>1.75'</u>                             | SUB PAVEMENT <u>NA</u>       |
| ELEV. (TOP)                                          | UTILITY DIRECTION <u>E-W</u> |
| COVER (BOTTOM)                                       |                              |
| ELEV. (BOTTOM)                                       |                              |
| W DTH <u>0.5"</u>                                    |                              |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

Owens



INDICATE NORTH

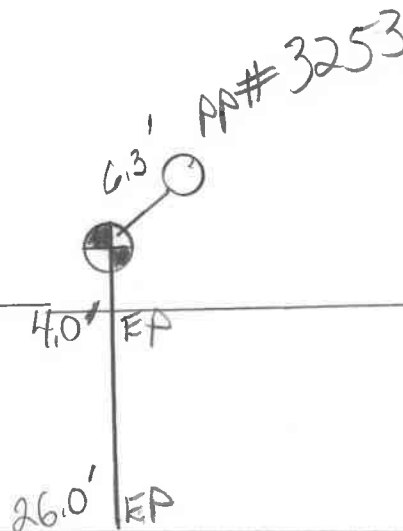




**VERIFY VERTICAL AND  
HORIZONTAL REPORT (VVH)**


TEST HOLE NO.: 315 C  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041-00 212  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 092036667

|                                                                                                                                                    |                     |                                 |  |                                               |                          |
|----------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|---------------------------------|--|-----------------------------------------------|--------------------------|
| REPORT BY: <u>P. Herold</u>                                                                                                                        |                     | ASSISTED BY: <u>P. Chasteen</u> |  | PROJECT NAME: JEA Galvanized Pipe Replacement |                          |
| CHECKED BY: _____                                                                                                                                  |                     |                                 |  | VVH REQUESTED BY: ETM                         |                          |
| NO. HOLES: <u>1</u>                                                                                                                                | DATE: <u>5/4/20</u> | TIME: _____                     |  | REQUESTED UTILITY: Water main                 |                          |
| UTILITY OWNER: JEA                                                                                                                                 |                     |                                 |  | LOCATED UTILITY: <u>WM</u>                    |                          |
| PAVEMENT TYPE: <u>Soft dis</u>                                                                                                                     |                     |                                 |  | MATERIAL AS FOUND: <u>PVC</u>                 | COLOR: <u>Blue</u>       |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                      |                     |                                 |  | SIZE AS EXPECTED: _____                       | SIZE AS FOUND: <u>6"</u> |
| SOIL CONDITIONS: SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                     |                                 |  | UTILITY CONDITION: <u>Good</u>                |                          |
| PROPOSED: Determine pipe material                                                                                                                  |                     |                                 |  | PAINT FLAGGED: <u>Blue</u>                    |                          |
| INSTALLED: IRON ROD & CAP LB3624 or <u>Nail &amp; disk</u><br>AT: CROWN, EDGE, OTHER _____                                                         |                     |                                 |  |                                               |                          |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                |                     |                                 |  |                                               |                          |
| NOTES:<br><u>FIND 6" Blue WM @ 2.01</u><br><u>see pics 136-3851 / 136-3853</u>                                                                     |                     |                                 |  |                                               |                          |
| Approx. STATION (±)                                                                                                                                |                     | OFFSET:                         |  |                                               |                          |

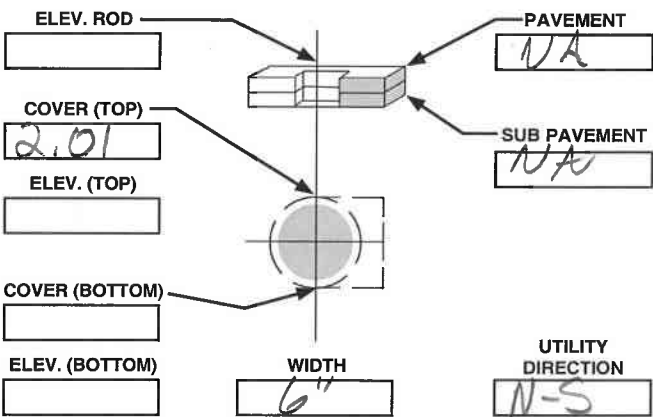

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

9.2' PP  
12.45' Hydrant  
9.1' stop sign  
PP# 3201  
Hydrant Fire  
9.2' 12.45'  
9.1' stop sign  
Day

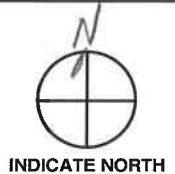

Rosselle




**VERIFY VERTICAL AND  
HORIZONTAL REPORT (VVH)**

TEST HOLE NO.: 316 C  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041-00 212  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 092006667

|                                                                                                                                                                                |                     |                                 |  |                                                |                           |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|---------------------------------|--|------------------------------------------------|---------------------------|
| REPORT BY: <u>P. Herold</u>                                                                                                                                                    |                     | ASSISTED BY: <u>P. Chastain</u> |  | PROJECT NAME: JEA Galvanized Pipe Replacement  |                           |
| CHECKED BY:                                                                                                                                                                    |                     |                                 |  | VVH REQUESTED BY: ETM                          |                           |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>5/5/20</u> | TIME:                           |  | REQUESTED UTILITY: <u>Water main</u> <u>FM</u> |                           |
| UTILITY OWNER: JEA                                                                                                                                                             |                     |                                 |  | LOCATED UTILITY: <u>FM</u>                     |                           |
| PAVEMENT TYPE: <u>Asphalt</u>                                                                                                                                                  |                     |                                 |  | MATERIAL AS FOUND: <u>PVC</u>                  | COLOR: <u>Green</u>       |
| PAVEMENT CONDITION: <u>fair</u>                                                                                                                                                |                     |                                 |  | SIZE AS EXPECTED:                              | SIZE AS FOUND: <u>24"</u> |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                     |                                 |  | UTILITY CONDITION: <u>Good</u>                 |                           |
| PROPOSED: Determine pipe material                                                                                                                                              |                     |                                 |  | PAINT FLAGGED: <u>Green</u>                    |                           |
| INSTALLED: IRON ROD & CAP LB3624 or <u>Nail &amp; disk</u>                                                                                                                     |                     |                                 |  |                                                |                           |
| AT: <u>CROWN</u> , EDGE, OTHER _____                                                                                                                                           |                     |                                 |  |                                                |                           |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                                            |                     |                                 |  |                                                |                           |
| NOTES:<br><u>FIND 24" Green PVC FM @ 5.32'</u><br><u>see pics 136-3854 / 136-3855</u>                                                                                          |                     |                                 |  |                                                |                           |
| Approx. STATION (±)                                                                                                                                                            |                     | OFFSET:                         |  |                                                |                           |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

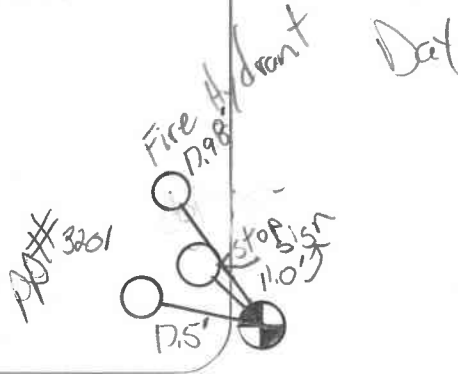

INDICATE NORTH




Rosselle



**VERIFY VERTICAL AND  
HORIZONTAL REPORT (VVH)**

TEST HOLE NO.: 317 C  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041-08 212  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 092006670

|                                                                                                                                                    |                     |                                 |  |                                               |                          |
|----------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|---------------------------------|--|-----------------------------------------------|--------------------------|
| REPORT BY: <u>P. Harold</u>                                                                                                                        |                     | ASSISTED BY: <u>P. Chasteen</u> |  | PROJECT NAME: JEA Galvanized Pipe Replacement |                          |
| CHECKED BY: _____                                                                                                                                  |                     |                                 |  | VVH REQUESTED BY: ETM                         |                          |
| NO. HOLES: <u>1</u>                                                                                                                                | DATE: <u>5/5/20</u> | TIME: _____                     |  | REQUESTED UTILITY: Water main                 |                          |
| UTILITY OWNER: JEA                                                                                                                                 |                     |                                 |  | LOCATED UTILITY: <u>WM</u>                    |                          |
| PAVEMENT TYPE: <u>Asphalt</u>                                                                                                                      |                     |                                 |  | MATERIAL AS FOUND: <u>PVC</u>                 | COLOR: <u>Blue</u>       |
| PAVEMENT CONDITION: <u>fair</u>                                                                                                                    |                     |                                 |  | SIZE AS EXPECTED: _____                       | SIZE AS FOUND: <u>6"</u> |
| SOIL CONDITIONS: SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                     |                                 |  | UTILITY CONDITION: <u>fair</u>                |                          |
| PROPOSED: Determine pipe material                                                                                                                  |                     |                                 |  | PAINT FLAGGED: <u>Blue</u>                    |                          |
| INSTALLED: IRON ROD & CAP LB3624 or <u>Naill &amp; disk</u><br>AT: CROWN, EDGE, OTHER _____                                                        |                     |                                 |  |                                               |                          |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                |                     |                                 |  |                                               |                          |
| NOTES:<br><u>FIND 6" Blue PVC WM @ 3.5'</u><br><u>see pic 136-3857/136-3858</u>                                                                    |                     |                                 |  |                                               |                          |
| Approx. STATION (±)                                                                                                                                |                     | OFFSET:                         |  |                                               |                          |

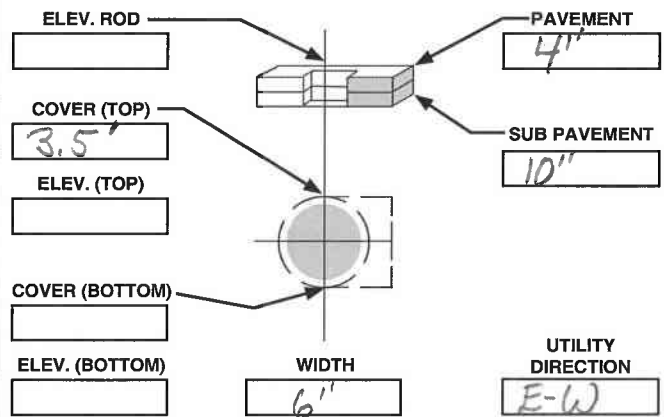


FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)



25.2 curb face

McDuff

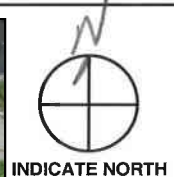

Rosselle

Rosselle







# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)


TEST HOLE NO.: 319  
PROJECT NO.: C  
WORK ORDER NO.: 212  
CLIENT PROJECT NO.: 19-047-00  
SUNSHINE-811 TICKET: 2980126684

|                                                                                                                                                                                        |                               |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|
| REPORT BY: <u>A. Hirschold</u>                                                                                                                                                         | ASSISTED BY: <u>A. Chaste</u> |
| CHECKED BY:                                                                                                                                                                            |                               |
| NO. HOLES: <u>1</u>                                                                                                                                                                    | DATE: <u>5/5/20</u> TIME:     |
| UTILITY OWNER: <u>JEA Teco</u>                                                                                                                                                         |                               |
| PAVEMENT TYPE: <u>Soft dig</u>                                                                                                                                                         |                               |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                          |                               |
| SOIL CONDITIONS: <input checked="" type="checkbox"/> SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                               |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                               |                               |
| INSTALLED: <u>IRON ROD &amp; CAP LB3624</u> or                                                                                                                                         |                               |
| A: <u>CROWN, EDGE,</u> OTHER:                                                                                                                                                          |                               |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                             |                               |
| NOTES:<br><u>FIND 1.5" Dark rusty GM @ 2.92'</u><br><u>see pics 136-3861 / 136-3862</u>                                                                                                |                               |
| Approx. STATION (±):                                                                                                                                                                   | OFFSET:                       |


|                                                  |                               |
|--------------------------------------------------|-------------------------------|
| PROJECT NAME: <u>Galvanized Pipe Replacement</u> |                               |
| VVH REQUESTED BY: <u>JEA</u>                     |                               |
| REQUESTED UTILITY: <u>Water main</u>             |                               |
| LOCATED UTILITY: <u>GM</u>                       |                               |
| MATERIAL AS FOUND: <u>GM</u>                     | COLOR: <u>Dark</u>            |
| SIZE AS EXPECTED:                                | SIZE AS FOUND: <u>1.5"</u>    |
| UTILITY CONDITION:                               |                               |
| PAINT FLAGGED: <u>door yellow</u>                |                               |
| ELEV. ROD                                        | AVEMENT: <u>NA</u>            |
| COVER (TOP): <u>2.92</u>                         | SUB PAVEMENT: <u>NA</u>       |
| ELEV. (TOP)                                      |                               |
| COVER (BOTTOM)                                   |                               |
| ELEV. (BOTTOM)                                   |                               |
| WI DTH: <u>1.5"</u>                              | UTILITY DIRECTION: <u>E-W</u> |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

*Shear*

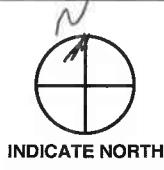

*Rosselle*

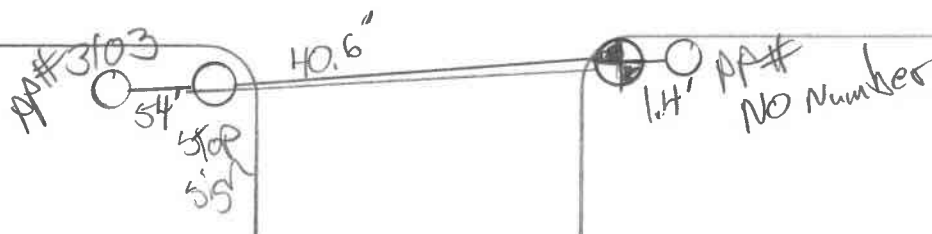


**VERIFY VERTICAL AND  
HORIZONTAL REPORT (VVH)**

TEST HOLE NO.: 322 C  
PROJECT NO.: \_\_\_\_\_  
WORK ORDER NO.: 19-041.00 212  
CLIENT PROJECT NO.: \_\_\_\_\_  
SUNSHINE-811 TICKET: 092 006 667

|                                                                                                                                                    |                                     |                                                                                                                                                                                                                                                                                                        |                                                   |
|----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------|
| REPORT BY: <u>P. Herold</u>                                                                                                                        | ASSISTED BY: <u>P. Chasteen</u>     | PROJECT NAME: JEA Galvanized Pipe Replacement                                                                                                                                                                                                                                                          |                                                   |
| CHECKED BY: _____                                                                                                                                  |                                     | VVH REQUESTED BY: ETM                                                                                                                                                                                                                                                                                  |                                                   |
| NO. HOLES: <u>1</u>                                                                                                                                | DATE: <u>5/6/20</u>                 | TIME: _____                                                                                                                                                                                                                                                                                            | REQUESTED UTILITY: <u>Water main</u> <u>water</u> |
| UTILITY OWNER: <u>JEA</u>                                                                                                                          |                                     | LOCATED UTILITY: <u>2 unknowns</u>                                                                                                                                                                                                                                                                     |                                                   |
| PAVEMENT TYPE: <u>Asphalt</u>                                                                                                                      | MATERIAL AS FOUND: <u>metal/PVC</u> | COLOR: <u>Rusty/white</u>                                                                                                                                                                                                                                                                              |                                                   |
| PAVEMENT CONDITION: <u>fair</u>                                                                                                                    | SIZE AS EXPECTED: _____             | SIZE AS FOUND: <u>4 1/2"</u>                                                                                                                                                                                                                                                                           |                                                   |
| SOIL CONDITIONS: SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                                     | UTILITY CONDITION: <u>very poor</u>                                                                                                                                                                                                                                                                    |                                                   |
| PROPOSED: Determine pipe material                                                                                                                  |                                     | PAINT FLAGGED: <u>PINK</u>                                                                                                                                                                                                                                                                             |                                                   |
| INSTALLED: IRON ROD & CAP LB3624 or <u>Nail &amp; disk</u>                                                                                         |                                     | <p>ELEV. ROD: _____</p> <p>COVER (TOP): <u>2.18/2.33</u></p> <p>ELEV. (TOP): _____</p> <p>COVER (BOTTOM): _____</p> <p>ELEV. (BOTTOM): _____</p> <p>PAVEMENT: <u>4"</u></p> <p>SUB PAVEMENT: <u>6"</u></p> <p>UTILITY DIRECTION: <u>N-S</u></p> <p>WIDTH: <u>46 1/2"</u></p> <p>Labels: metal, PVC</p> |                                                   |
| AT: CROWN, EDGE, OTHER _____                                                                                                                       |                                     |                                                                                                                                                                                                                                                                                                        |                                                   |
| JOB MEASUREMENT TYPE: Tenths - Feet                                                                                                                |                                     |                                                                                                                                                                                                                                                                                                        |                                                   |
| NOTES:<br><u>FND 4 1/2" Rusty metal pipe @ 2.18'</u><br><u>FND 2" white PVC pipe @ 2.33'</u><br><u>see pics 136-3868 / 136-3869</u>                |                                     |                                                                                                                                                                                                                                                                                                        |                                                   |
| Approx. STATION (±): _____                                                                                                                         | OFFSET: _____                       |                                                                                                                                                                                                                                                                                                        |                                                   |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

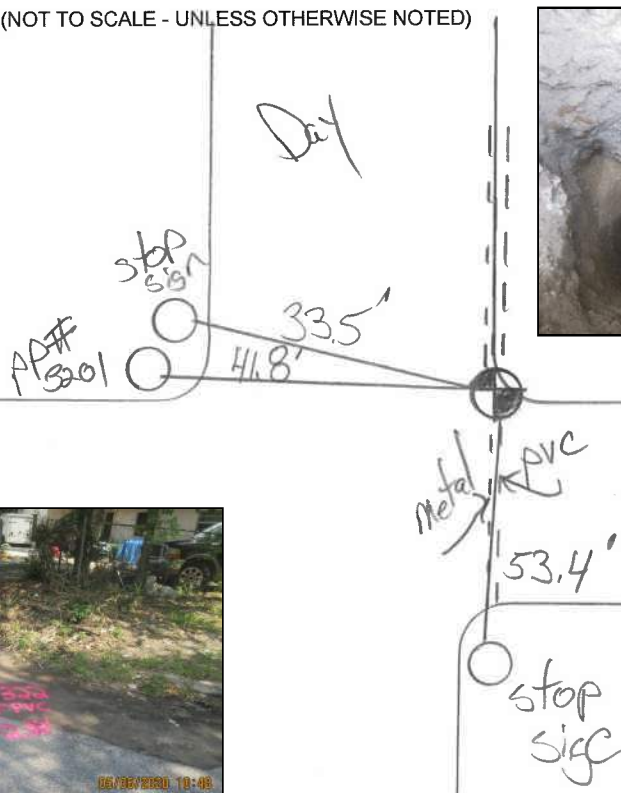


# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 323 C  
PROJECT NO.: 19-04100 212  
WORK ORDER NO.: 19-04100 212  
CLIENT PROJECT NO.: 19-04100 212  
SUNSHINE-811 TICKET: 0920126670

|                                                                                                                                                                                |                               |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|------------------------------------------------------|
| REPORT BY: <u>PHero</u>                                                                                                                                                        | ASSISTED BY: <u>PChastren</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY:                                                                                                                                                                    |                               | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>5/6/20</u>           | TIME:                                                |
| UTILITY OWNER: <u>JEA Teco</u>                                                                                                                                                 |                               | REQUESTED UTILITY: <u>Water main</u>                 |
| PAVEMENT TYPE: <u>Soft dig</u>                                                                                                                                                 |                               | LOCATED UTILITY: <u>Gas Main</u>                     |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                  |                               | MATERIAL AS FOUND: <u>4" k metal conduit</u>         |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                               | COLOR: <u>Rust</u>                                   |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                               | SIZE AS EXPECTED:                                    |
| INSTALLED: <u>IRON ROD &amp; CAP LB3624 or Disk &amp; Nail</u>                                                                                                                 |                               | SIZE AS FOUND: <u>4"</u>                             |
| AT: <u>CROWN</u> , EDGE, OTHER                                                                                                                                                 |                               | UTILITY CONDITION:                                   |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                               | PAINT FLAGGED: <u>Very Poor</u>                      |
| NOTES: <u>Found 4" rusty metal conduit @ 1.90'</u>                                                                                                                             |                               |                                                      |
| Approx. STATION (±): <u>136-38.70 / 136-38.71</u>                                                                                                                              |                               |                                                      |
| OFFSET:                                                                                                                                                                        |                               |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

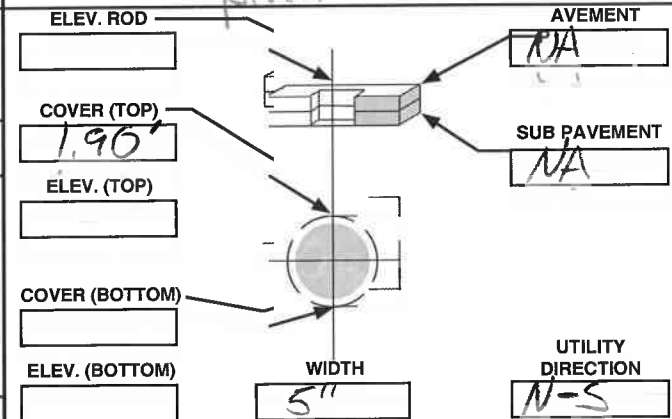







# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 34 C  
PROJECT NO.: 19-041-00 212  
WORK ORDER NO.: 19-041-00 212  
CLIENT PROJECT NO.: 6  
SUNSHINE-811 TICKET: 92006658

|                                                                                                                                                                                |                                 |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|------------------------------------------------------|
| REPORT BY: <u>P. Harold</u>                                                                                                                                                    | ASSISTED BY: <u>P. Chastain</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: <u>P. Harold</u>                                                                                                                                                   |                                 | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>5/1/20</u>             | TIME: <u></u>                                        |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                      |                                 | REQUESTED UTILITY: <u>Water main</u>                 |
| PAVEMENT TYPE: <u>Soft dis</u>                                                                                                                                                 |                                 | LOCATED UTILITY: <u>FM</u>                           |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                  |                                 | MATERIAL AS FOUND: <u>steel</u>                      |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                                 | SIZE AS EXPECTED: <u></u>                            |
| PROPOSED: Determine <u>pipe</u> material                                                                                                                                       |                                 | SIZE AS FOUND: <u>6"</u>                             |
| INSTALL <u>IRON ROD &amp; D. CAP LB3624</u> or <u></u>                                                                                                                         |                                 | PAINT FLAGGED: <u>fair green</u>                     |
| AT: <u>CROWN</u> , EDGE, OTHER <u></u>                                                                                                                                         |                                 |                                                      |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                                 |                                                      |
| NOTES: <u>FIND 6" Rust/silver metal FM @ 5.37</u>                                                                                                                              |                                 |                                                      |
| <u>see pics 136-3892/136-3893</u>                                                                                                                                              |                                 |                                                      |
| Appro <u>X</u> STATION (±) <u></u>                                                                                                                                             | OFFSET: <u></u>                 |                                                      |

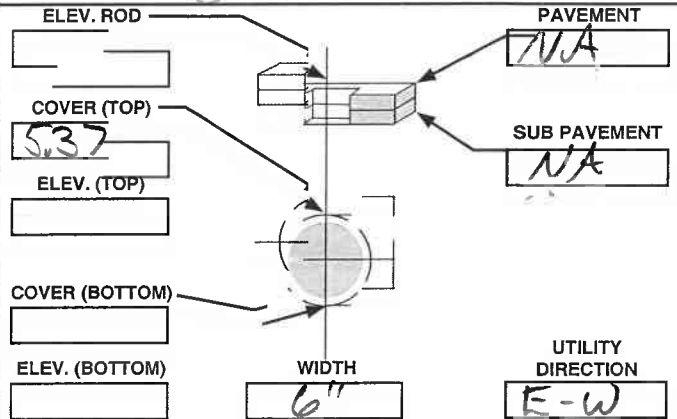

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

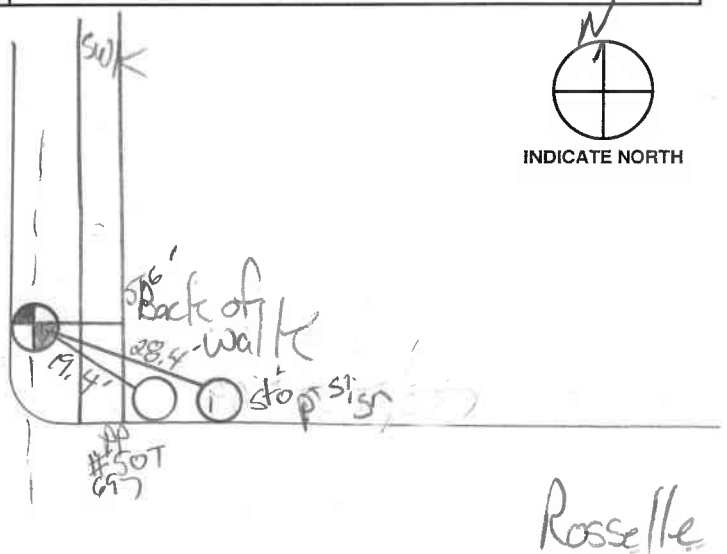




# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 335  
PROJECT NO.: C  
WORK ORDER NO.:  
CLIENT PROJECT NO.: 19-041-00 212  
SUNSHINE-811 TICKET: 128067167

|                                                                                                                                                                                        |                                 |                                                      |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|------------------------------------------------------|
| REPORT BY: <u>D. H. 10/6</u>                                                                                                                                                           | ASSISTED BY: <u>P. Christen</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY:                                                                                                                                                                            |                                 | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                                    | DATE: <u>5/11/20</u>            | TIME:                                                |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                              | <u>WATER GM + ECO</u>           | REQUESTED UTILITY: <u>Water main - 48" GM</u>        |
| PAVEMENT TYPE: <u>soft g/l's</u>                                                                                                                                                       |                                 | LOCATED UTILITY: <u>WATER GM</u>                     |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                          |                                 | MATERIAL AS FOUND: <u>PVC</u> COLOR: <u>white</u>    |
| SOIL CONDITIONS: <input checked="" type="checkbox"/> SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                                 | SIZE AS EXPECTED: SIZE AS FOUND: <u>1.5'</u>         |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                               |                                 | UTILITY CONDITION:                                   |
| INSTALLED <u>IRON ROD &amp; CAP LB3</u> or <u>624</u>                                                                                                                                  |                                 | PAINT FLAGGED: <u>POOR</u><br><u>pink yellow</u>     |
| AT. CROWN <u>EDGE, OTHER</u>                                                                                                                                                           |                                 | ELEV. ROD                                            |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                             |                                 | COVER (TOP) <u>2.38</u>                              |
| NOTES:<br><u>FIND 1.5" white PVC pipe @ 2.38'</u><br><u>Near metal rust valve</u><br><u>see pic 136-3894 / 136-3896</u>                                                                |                                 | ELEV. (TOP)                                          |
| Approx. STATION (±) <u>3119</u>                                                                                                                                                        | OFFSET:                         | COVER (BOTTOM)                                       |
|                                                                                                                                                                                        |                                 | ELEV. (BOTTOM)                                       |
|                                                                                                                                                                                        |                                 | WIDTH <u>1.5'</u>                                    |
|                                                                                                                                                                                        |                                 | UTILITY DIRECTION <u>E-W</u>                         |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

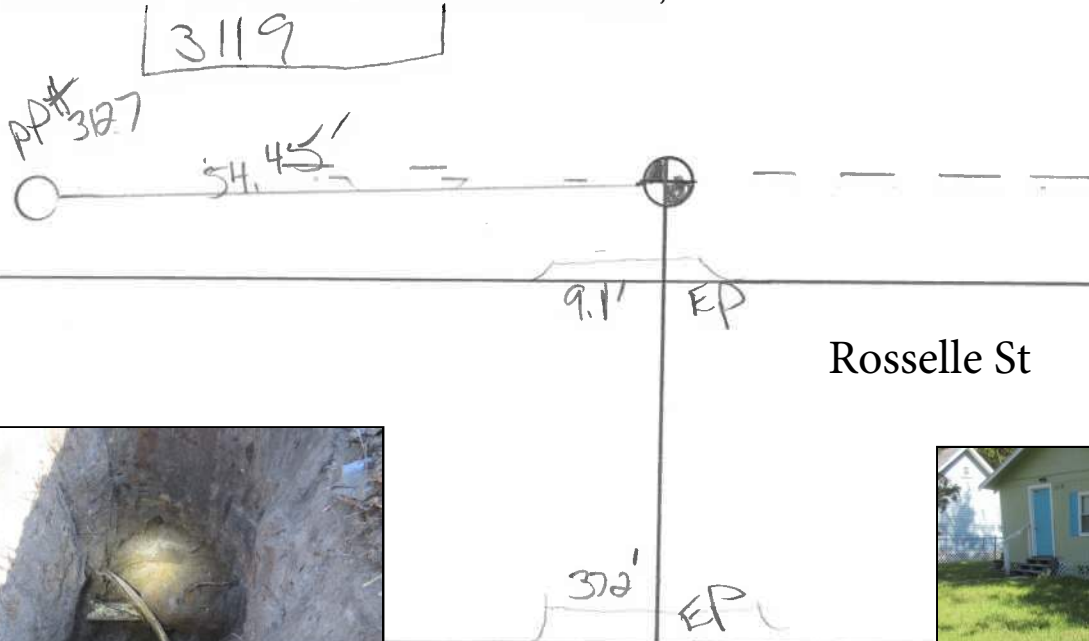

Rosselle St








# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 336C  
PROJECT NO.: 19-041-00 212  
WORK ORDER NO.: 19-041-00 212  
CLIENT PROJECT NO.: 19-041-00 212  
SUNSHINE-811 TICKET: 188007170

|                                                                                                                                                                                |                               |                                                      |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|------------------------------------------------------|
| REPORT BY: <u>P Herold</u>                                                                                                                                                     | ASSISTED BY: <u>P Chester</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY:                                                                                                                                                                    |                               | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>5/11/20</u>          | TIME:                                                |
| UTILITY OWNER: <u>JEA Teco</u>                                                                                                                                                 |                               | REQUESTED UTILITY: <u>Water main 6M</u>              |
| PAVEMENT TYPE: <u>Soft dis</u>                                                                                                                                                 |                               | LOCATED UTILITY: <u>6M</u>                           |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                  |                               | MATERIAL AS FOUND: <u>+</u>                          |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                               | COLOR: <u>+</u>                                      |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                       |                               | SIZE AS EXPECTED: <u>+</u>                           |
|                                                                                                                                                                                |                               | SIZE AS FOUND: <u>+</u>                              |
| INSTALL IRON ROD & CAP LB <u>3624</u>                                                                                                                                          |                               | UTILITY CONDITION:                                   |
| A. <u>O</u> OTHER <u>+</u>                                                                                                                                                     |                               | PAINT FLAGGED: <u>Yellow</u>                         |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                               |                                                      |
| NOTES:<br><u>FIND 4" Metal pipe @ 281'</u><br><u>probably metal conduit for gas</u><br><u>see NCS 136-3897/136-3898</u>                                                        |                               |                                                      |
| Approx. STATION (±)                                                                                                                                                            | OFFSET:                       |                                                      |

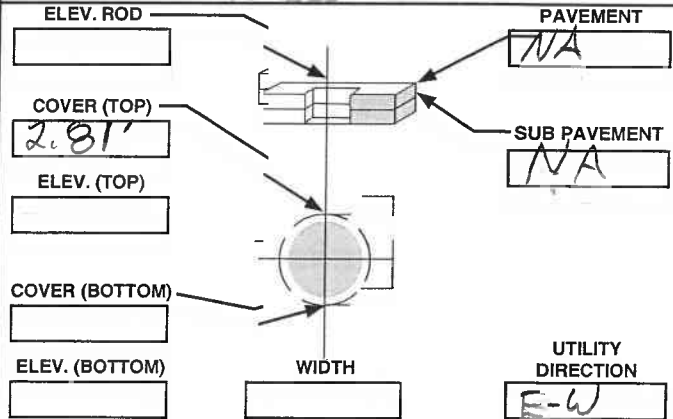

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

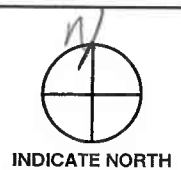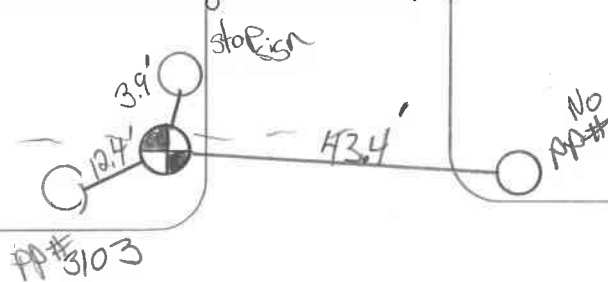

Rosselle



Shearer








# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 337 C  
PROJECT NO.: 19-041.00 212  
WORK ORDER NO.: 19-041.00 212  
CLIENT PROJECT NO.:         
SUNSHINE-811 TICKET: 128007170

|                                                                                                                                                                             |                             |                                                      |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------|------------------------------------------------------|
| REPORT BY: <u>P. Herold</u>                                                                                                                                                 | ASSISTED BY: <u>P. Chas</u> | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: <u>      </u>                                                                                                                                                   |                             | VVH REQUESTED BY: <u>ETM</u>                         |
| NO. HOLES: <u>1</u>                                                                                                                                                         | DATE: <u>5/11/20</u>        | ME: <u>TI</u>                                        |
| UTILITY OWNER: <u>JEA</u>                                                                                                                                                   |                             | UTILITY: <u>Water main Com.</u>                      |
| PAVEMENT TYPE: <u>30 AT d/s</u>                                                                                                                                             |                             | REQUESTED: <u>Water main Com.</u>                    |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                               |                             | LOCATED UTILITY: <u>      </u>                       |
| SOIL CONDITIONS: <input type="checkbox"/> SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/> |                             | MATERIAL AS FOUND: <u>Com PE</u>                     |
| PROPOSED: <u>Determine material p pe</u>                                                                                                                                    |                             | COLOR: <u>orange</u>                                 |
| INST: <u>IRON ROD &amp; CAP LB</u> or <u>3624</u>                                                                                                                           |                             | SIZE AS EXPECTED: <u>      </u>                      |
| A: <u>T. CROWN, EDGE</u>                                                                                                                                                    |                             | SIZE AS FOUND: <u>2"</u>                             |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                  |                             | UTILITY CONDITION: <u>fair</u>                       |
| NOTES: <u>FND 2" Orange PE conduit @ 5.31'</u><br><u>see pic 136-3899/136-3900</u>                                                                                          |                             | PAINT FLAGGED: <u>Orange</u>                         |
| A: <u>STATION (±)</u>                                                                                                                                                       | OFFSET: <u>      </u>       | ELEV. ROD: <u>      </u>                             |
|                                                                                                                                                                             |                             | COVER (TOP): <u>5.31'</u>                            |
|                                                                                                                                                                             |                             | ELEV. (TOP): <u>      </u>                           |
|                                                                                                                                                                             |                             | COVER (BOTTOM): <u>      </u>                        |
|                                                                                                                                                                             |                             | ELEV. (BOTTOM): <u>      </u>                        |
|                                                                                                                                                                             |                             | WIDTH: <u>2"</u>                                     |
|                                                                                                                                                                             |                             | UTILITY DIRECTION: <u>N-S</u>                        |
|                                                                                                                                                                             |                             | PAVEMENT: <u>N/A</u>                                 |
|                                                                                                                                                                             |                             | SUB PAVEMENT: <u>N/A</u>                             |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

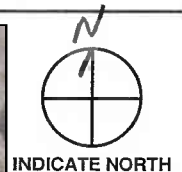

sheares  
AS 3301  
3.6' EP  
31.8' EP

Rosselle



# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)


TEST HOLE NO.: 338 C  
PROJECT NO.: 338  
WORK ORDER NO.: 212  
CLIENT PROJECT NO.: 19-04100  
SUNSHINE-811 TICKET: 123007170

|                                                                                                                                                                                 |                                      |                                                      |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|------------------------------------------------------|
| REPORT BY: <u>P. Herold</u>                                                                                                                                                     | ASSISTED BY: <u>P. Chester</u>       | PROJECT NAME: <u>JEA Galvanized Pipe Replacement</u> |
| CHECKED BY: <u>Herold</u>                                                                                                                                                       | VVH REQUESTED BY: <u>ETM</u>         |                                                      |
| G. HOLES: <u>1</u>                                                                                                                                                              | DATE: <u>5/11/20</u>                 | TIME: <u></u>                                        |
| UTILITY OWNER: <u>JEA Teco</u>                                                                                                                                                  | REQUESTED UTILITY: <u>Water main</u> |                                                      |
| PAVEMENT TYPE: <u>Soft dig</u>                                                                                                                                                  | LOCATED UTILITY: <u>GM</u>           |                                                      |
| PAVEMENT CONDITION: <u>NA</u>                                                                                                                                                   | MATERIAL AS FOUND: <u>CI</u>         | COLOR: <u>Rust</u>                                   |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRTY</u> <input checked="" type="checkbox"/> | SIZE AS EXPECTED: <u></u>            | SIZE AS FOUND: <u>6</u>                              |
| PROPOSED: <u>Determine pipe material</u>                                                                                                                                        | UTILITY CONDITION: <u>Good</u>       |                                                      |
| INSTALL <u>IRON ROD &amp; CAP LB3624</u>                                                                                                                                        | PAINT FLAGGED: <u>Yellow</u>         |                                                      |
| ED: <u>GE, OTHER</u>                                                                                                                                                            | ELEV. ROD: <u></u>                   |                                                      |
| AT: <u>CROWN, ED</u>                                                                                                                                                            | COVER (TOP): <u>2.00'</u>            |                                                      |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                      | ELEV. (TOP): <u></u>                 |                                                      |
| NOTES: <u>FIND 6" Rusty GM @ 200'</u>                                                                                                                                           | COVER (BOTTOM): <u></u>              |                                                      |
| <u>Supplies 136-3901 / 136-3902</u>                                                                                                                                             | ELEV. (BOTTOM): <u></u>              |                                                      |
| Appr. <u>ox.</u> STATION (±): <u>3033</u>                                                                                                                                       | WIDTH: <u>6.5"</u>                   |                                                      |
| OFFSET: <u></u>                                                                                                                                                                 | UTILITY DIRECTION: <u>E-W</u>        |                                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

3033

3029

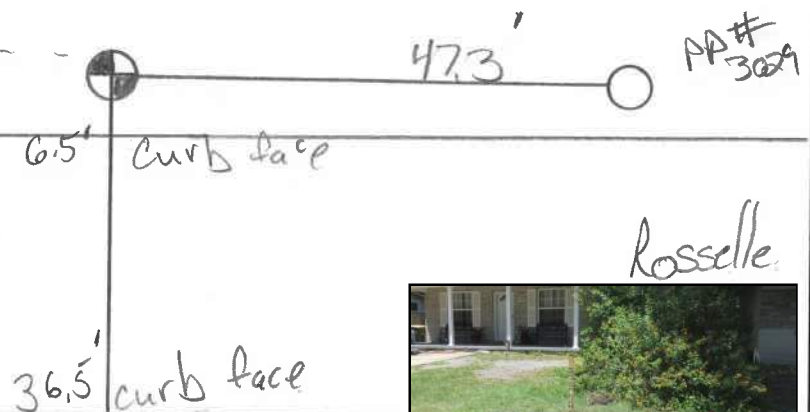


# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 455



WORK ORDER NO.: 19-212, 04(C)

SUNSHINE-811 TICKET: 27200344

|                                                                                                                                                                                          |                              |                                 |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|---------------------------------|
| REPORT BY: <u>A Herold</u>                                                                                                                                                               | ASSISTED BY: <u>R Zamora</u> | PROJECT NAME: <u>A Galv</u>     |
| CHECKED BY:                                                                                                                                                                              |                              | VVH REQUESTED BY: <u>JE TMA</u> |
| NO. HOLES: <u>1</u>                                                                                                                                                                      | DATE: <u>10/1/20</u>         | TIME:                           |
| UTILITY OWNER: <u>A1GT</u>                                                                                                                                                               |                              | REQUESTED UTILITY: <u>Com</u>   |
| PAVEMENT TYPE: <u>Asphalt</u>                                                                                                                                                            |                              | LOCATED UTILITY: <u>Com</u>     |
| PAVEMENT CONDITION:                                                                                                                                                                      |                              | MATERIAL AS FOUND: <u>PE</u>    |
| SOIL CONDITIONS: <input checked="" type="checkbox"/> SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> L <input checked="" type="checkbox"/> DIRT |                              | C LOR: <u>Orange</u>            |
| PROPOSED: <u>locate utility</u>                                                                                                                                                          |                              | SIZE AS EXPECTED:               |
| INSTALLED: IRON ROD & CAP LB3624 or <u>1" rail disk</u>                                                                                                                                  |                              | SIZE AS FOUND: <u>3"</u>        |
| A. <input checked="" type="checkbox"/> CROWN, <input type="checkbox"/> EDGE, OTHER                                                                                                       |                              | UTILITY CONDITION: <u>Good</u>  |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                               |                              | PAINT FLAGGED: <u>Orange</u>    |
| NOTES: <u>3" orange PE com @ 4.78'</u>                                                                                                                                                   |                              |                                 |
| see pics 101-0007/0008                                                                                                                                                                   |                              |                                 |
| Approx. STATION (±)                                                                                                                                                                      | OFFSET:                      |                                 |

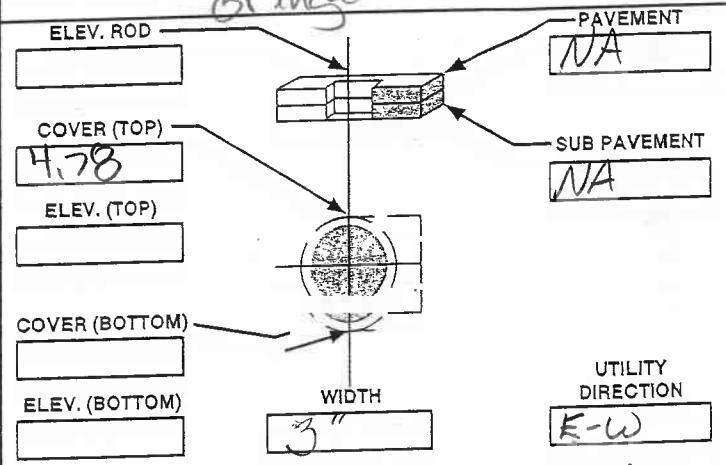

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

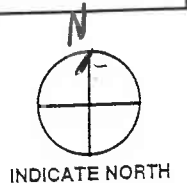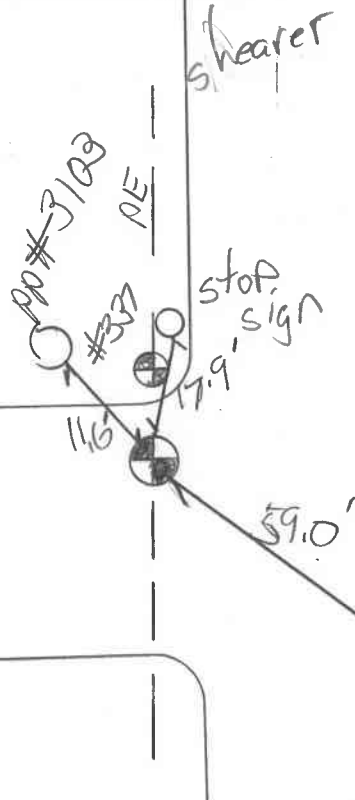

Roselle





# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 19-212.04(C)  
WORK ORDER NO.: 19-212.04(C)  
SUNSHINE-811 TICKET: 27200395

|                                                                                                                                                            |                              |                                      |
|------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|--------------------------------------|
| REPORT BY: <u>PHerold</u>                                                                                                                                  | ASSISTED BY: <u>R Zamora</u> | PROJECT NAME: <u>JEFA Gm</u>         |
| CHECKED BY:                                                                                                                                                |                              | VVH REQUESTED BY: <u>ETM</u>         |
| NO. HOLES: <u>1</u>                                                                                                                                        | DATE: <u>10/10/20</u>        | TIME:                                |
| UTILITY OWNER: <u>IECO</u>                                                                                                                                 |                              | REQUESTED UTILITY: <u>Gm</u>         |
| PAVEMENT TYPE: <u>Asphalt</u>                                                                                                                              |                              | LOCATED UTILITY: <u>Gm / unk</u>     |
| PAVEMENT CONDITION: <u>moor</u>                                                                                                                            |                              | MATERIAL AS FOUND: <u>Steel Galv</u> |
| SOIL CONDITIONS: SOFT <input type="checkbox"/> DRY <input type="checkbox"/> CLAY <input type="checkbox"/> DIRT <input checked="" type="checkbox"/>         |                              | COLOR: <u>Rust</u>                   |
| PROPOSED: <u>locate utility</u>                                                                                                                            |                              | SIZE AS EXPECTED: <u>4"</u>          |
| INSTALLED: IRON ROD & CAP LB3624 or <u>1/4" disk x 2</u>                                                                                                   |                              | SIZE AS FOUND: <u>4 1/2"</u>         |
| A <u>T. CROWN</u> EDGE, OTHER                                                                                                                              |                              | UTILITY CONDITION: <u>moor</u>       |
| JOE MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                 |                              | PAINT FLAGGED: <u>yellow / pink</u>  |
| NOTES:<br>FND 4" rusty steel Gm @ 2'45"<br>FND 2" rusty old Galv (unk) @ 1'75"<br>4" capped nail & disk directly above it<br>see pics 101-0027/28/29/30/31 |                              |                                      |
| Approx. STATION (±):                                                                                                                                       | OFFSET:                      |                                      |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED)

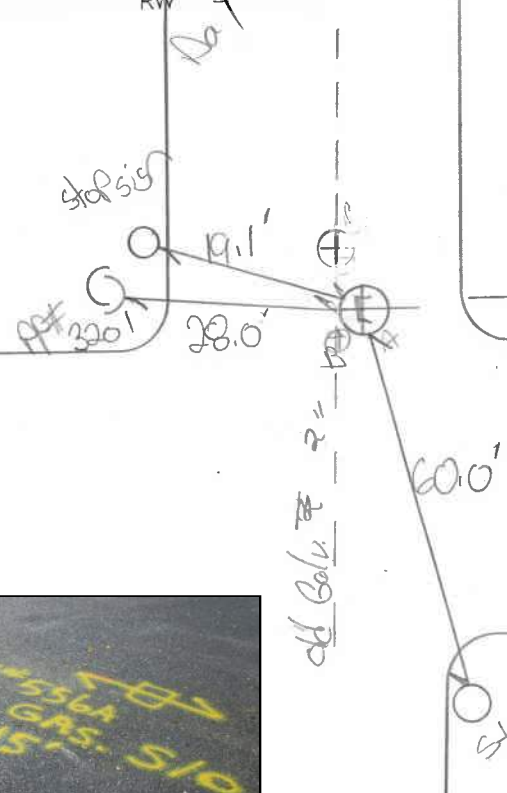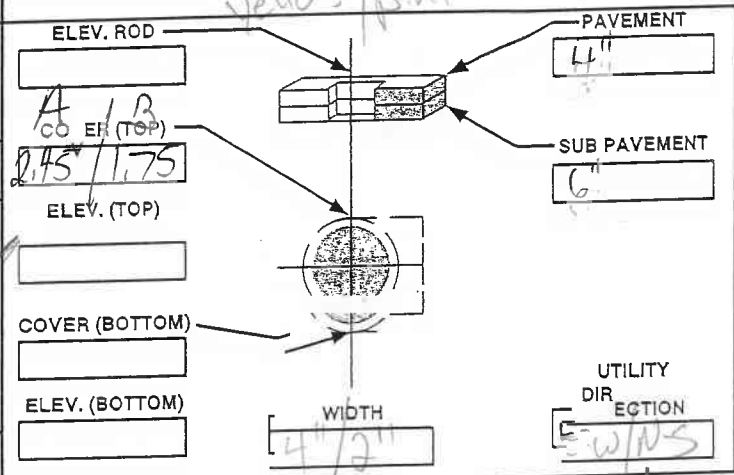

# VERIFY VERTICAL AND HORIZONTAL REPORT (VVH)

TEST HOLE NO.: 457  
WORK ORDER NO.: 19-212.04(C)  
SUNSHINE-811 TICKET: 7200344

|                                                                                                                                                                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                                                    |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------|
| REPORT BY: <u>P Herold</u>                                                                                                                                                     | ASSISTED BY: <u>R Zamora</u>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | PROJECT NAME: <u>J</u>                             |
| CHECKED BY:                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | VVH REQUESTED BY: <u>EA</u>                        |
| NO. HOLES: <u>1</u>                                                                                                                                                            | DATE: <u>10/7/20</u>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | TIME:                                              |
| UTILITY OWNER: <u>JE A</u>                                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | REQUESTED UTILITY: <u>Sewer Service from house</u> |
| PAVEMENT TYPE: <u>Soft dx Asphalt</u>                                                                                                                                          |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | LOCATED UTILITY: <u>sewer</u>                      |
| PAVEMENT CONDITION: <u>Asphalt</u>                                                                                                                                             |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | MATERIAL AS FOUND: <u>PVC</u>                      |
| SOIL CONDITIONS: <u>SOFT</u> <input type="checkbox"/> <u>DRY</u> <input type="checkbox"/> <u>CLAY</u> <input type="checkbox"/> <u>DIRT</u> <input checked="" type="checkbox"/> |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | COLOR: <u>Green</u>                                |
| PROPOSED: <u>locate utility</u>                                                                                                                                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | SIZE AS EXPECTED:                                  |
| INSTALLED: IRON ROD & CAP LB36 or <u>1/4" disk</u>                                                                                                                             |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | SIZE AS FOUND: <u>6"</u>                           |
| AT: <u>CROWN</u> , EDGE, OTHER                                                                                                                                                 |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | UTILITY CONDITION: <u>Good</u>                     |
| JOB MEASUREMENT TYPE: <u>Tenths - Feet</u>                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | PAINT FLAGGED: <u>Green</u>                        |
| NOTES:<br><u>FIND 6" Green PVC sewer service @ 3.15</u><br><u>see pics 141-4654/55/56/57</u>                                                                                   | <div style="display: flex; justify-content: space-around;"> <div> <p>ELEV. ROD</p><div style="border: 1px solid black; width: 100px; height: 20px;"></div> <p>COVER (TOP)</p><div style="border: 1px solid black; width: 100px; height: 20px; text-align: center;">3.15</div> <p>ELEV. (TOP)</p><div style="border: 1px solid black; width: 100px; height: 20px;"></div> <p>COVER (BOTTOM)</p><div style="border: 1px solid black; width: 100px; height: 20px;"></div> <p>ELEV. (BOTTOM)</p><div style="border: 1px solid black; width: 100px; height: 20px;"></div> </div> <div style="text-align: center;"> <p>WIDTH</p><div style="border: 1px solid black; width: 100px; height: 20px; text-align: center;">6"</div> </div> <div> <p>PAVEMENT</p><div style="border: 1px solid black; width: 100px; height: 20px; text-align: center;">4"</div> <p>SUB PAVEMENT</p><div style="border: 1px solid black; width: 100px; height: 20px; text-align: center;">6"</div> <p>UTILITY DIRECTION</p><div style="border: 1px solid black; width: 100px; height: 20px; text-align: center;">N-S</div> </div> </div> |                                                    |
| Approx. STATION (±)                                                                                                                                                            | OFFSET:                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                                                    |

FIELD SKETCH: (NOT TO SCALE - UNLESS OTHERWISE NOTED) 3033 / House

